EDEXCEL NATIONAL CERTIFICATE/DIPLOMA SCIENCE FOR TECHNICIANS

OUTCOME 2 - ELECTRICAL PRINCIPLES

TUTORIAL 3 – MAGNETISM

2 Electrical principles

Electrical energy: electric charge, charged conductors, conductors and insulators, resistivity and resistance, potential difference, electro-motive force, voltage, current

Dc circuits: Ohm's law, current, voltage and resistance in a simple circuit, series and parallel circuits, combined series/parallel circuits, Kirchoff's laws, elementary electrical power formulae

Magnetism: permanent magnets and magnetic fields, magnetic effect of a current, electromagnets, electro-magnetic induction, transformers, Lenz's and Faraday's laws, generator principle, motor principle

You should judge your progress by completing the self assessment exercises. These may be sent for marking at a cost (see home page).


CONTENTS

- MAGNETISM
- PERMANENT MAGNET
- ELECTRO-MAGNETISM
- MAGNETIC CIRCUIT
- FLUX AND FLUX DENSITY
- MAGNETIC CIRCUIT
- MAGNETO MOTIVE FORCE m.m.f.
- MAGNETISING FORCE H
- RELATIONSHIP BETWEEN B AND H
- FORCE ON A CONDUCTOR MOTOR PRINCIPLE
 - FORCE
 - TORQUE ON A LOOP
 - MOVING COIL METER
- THE GENERATOR PRINCIPLE
 - COIL AND MAGNET
 - CONDUCTOR CROSSING A UNIFORM FLUX
 - FLEMING'S RIGHT HAND RULE

1. MAGNETISM

1.1 **PERMANENT MAGNET**

A permanent magnet produces a magnetic field with lines of magnetism running from North to South. This is a three dimensional field with the lines radiating out in all directions. In two dimensions, these lines may be traced out with a needle compass or by spreading iron filings around the magnet. The diagram shows a typical pattern.

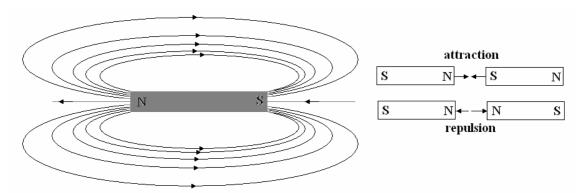


When two magnets are placed close as shown, opposite poles attract and like poles repel. Only certain materials are magnetic, mainly those containing iron.

It is thought that the molecules themselves are like magnets and line up along the length of the magnet in a pattern of N - S - N - s -.... If this is broken up by hammering or heating, the permanent magnetism is lost.

1.2 ELECTRO-MAGNETISM

CURRENT CONVENTION

In the following work you should be aware of the following convention for indicating the direction of an electric current. When a cross section through a conductor is carrying current away from you, a cross is used. When the current is coming towards you, a dot is used. This should be seen as an arrow or dart. Moving away you see the tail feathers as a cross. Coming towards you, you see the point as a dot.

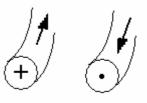


MAGNETIC FIELD AROUND A CONDUCTOR


When a current flows in a conductor, a magnetic field is produced and the lines of magnetism are concentric circles around the cross section as shown. The direction may be found with a compass needle. The direction of the lines is determined by the CORK SCREW RULE. Point your finger in the direction of the current and turn your hand as

though doing up a screw. The rotation is the direction of the magnetic flux.


Consider the resulting magnetic field when two conductors are placed parallel to each other.

When the current is in opposite directions, the field is concentrated in the space between them. When the current is in the same direction, the lines join up. Lines of magnetism do not flow easily in the opposite direction to each other and take an easier route by joining up.

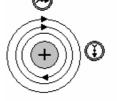


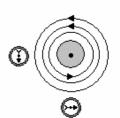

Opposite Currents

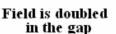

Same Currents

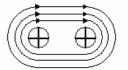

Field combines in one direction

Now consider what happens when a conductor is wound into a coil. Taking a cross section we see that the current is always flowing into the page on top and out on the bottom. The circular lines of magnetism join up to form a pattern very similar to the bar magnet. This may be switched off or reversed by reversing the current. This is the way an electromagnetic field is created. This affect is u8sed in solenoids and magnetic cranes.

SOLENOIDS

A solenoid is a coil with an iron plunger inside it. When current flows in the coil, the plunger becomes magnetised and tries to move out of the coil. If a spring is used to resist the movement, the distance moved is directly proportional to the current in the coil. Solenoids are used in relays where they operate an electric switch. They are also used in hydraulic and pneumatic valves to move the valve element.

CRANES

When the coil is energised with current a powerful magnetic field is created and this is concentrated by the iron core and attracts any iron. It is useful for lifting iron and for sorting iron from non-magnetic materials.

2. <u>MAGNETIC CIRCUIT</u>


2.1 FLUX AND FLUX DENSITY

The magnetic field is more correctly known as the magnetic flux and has the symbol ϕ or Φ . It is


measured in units called the Weber (Wb). In the iron part of the magnet, the flux flows through a cross section of area A. The flux per unit cross sectional area is called the flux density and has a symbol B. The unit is the Weber/m² or Tesla (T). ϕ - flux (Wb)

B – flux density (T)

$$\mathbf{B} = \mathbf{\phi} / \mathbf{A}$$

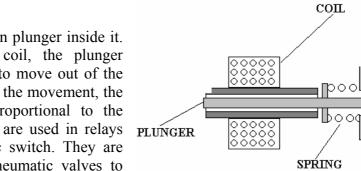


Current

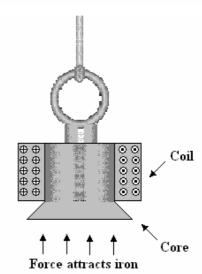

Cross Section

MOVEMENT

Flux ø

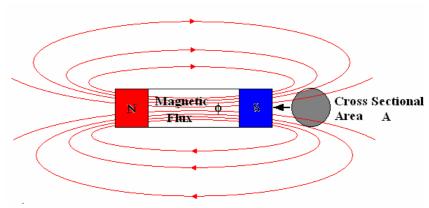





2.2 MAGNETIC CIRCUIT

Note that the flux is assumed to have a direction North to South on the outside but South to North on the inside. The poles of a magnet are Red for North and Blue for South. The flux flowing on the outside has an indeterminate cross section and length but flux flowing in a magnetic core has a definite cross sectional area and length and this is important in the next section.

In the horse shoe magnet shown in the next example, the flux runs through the iron and then jumps across the air gap. The flux is concentrated in the gap and the gap has a definite cross sectional area and length.

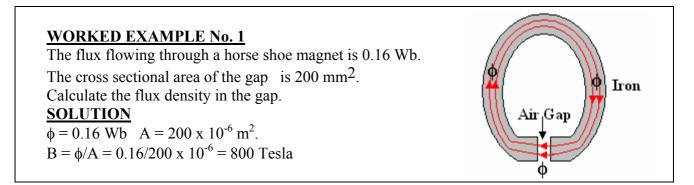

In the following work, it is useful to think of a magnetic flux created by a coil wound on a ring (toroid) of magnetic material as shown. This ring forms a complete circuit of uniform cross sectional area A and length l. In the simple electric circuit shown, the current flowing depends on the voltage V and the resistance R.

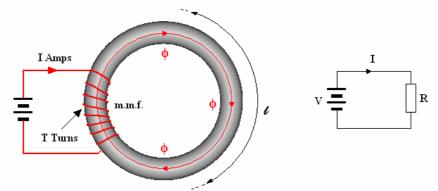

In the magnetic circuit, a flux ϕ flows. The strength of the flux depends on the coil and this property is called the **MAGNETO MOTIVE FORCE** (m.m.f.). This is equivalent (analogous) to the voltage. We need a property equivalent to resistance to describe how easy it is for the flux to flow. This property is called **RELUCTANCE**.

Electrical resistance depends on a property of the material called the conductivity (or resistivity). Different materials have different electrical resistance (Silver is the best but copper is very good). In the same way, the reluctance of a material depends on a property called the **PERMEABILITY** (iron is good but there are even better materials).

2.3 <u>MAGNETO MOTIVE FORCE m.m.f.</u>

The m.m.f. is created by the current flowing in the coil. It is directly proportional to the current 'I' and the number of turns of the coil 'T'.

m.m.f. = **I T** The units are Ampere Turns (A T)

Permanent magnets have a theoretical m.m.f to explain the permanent flux. In order to understand magneto motive force, we need to study the closely related topic of magnetising force next. © D.J.Dunn freestudy.co.uk 4

2.4 MAGNETISING FORCE H

The toroid in the previous section formed a complete ring of uniform cross section. The length l is the mean circumference of the ring. The magnetising force is defined as the m.m.f. divided by l.

H = I T/1 The units are Ampere turns per metre.

WORKED EXAMPLE No. 2

A coil is wound on a toroid core 50 mm mean diameter. There are 500 turns. Calculate the m.m.f. and the Magnetising force when a current of 2 A is applied.

SOLUTION

m.m.f. = I T = $2 \times 500 = 1000$ Ampere Turns

 $l = circumference = \pi D = \pi \ge 0.05 = 0.157 \text{ m}$

H = m.m.f./l = 1000/0.157 = 6366.2 AT/m

2.5 <u>RELATIONSHIP BETWEEN B AND H</u>

The toroid has a uniform cross sectional area A so the flux density is simply $B = \phi/A$.

The flux and hence flux density depends on the m.m.f. and hence the magnetising force.

For any coil it is found that B/H = constant. Here it gets a bit difficult because unless the material is magnetic, the flux will flow through the air and the length of the magnetic circuit is not apparent. It has been found that for a simple coil with no core at all (a complete vacuum), the constant is 12.566 x 10⁻⁷ and this is called the ABSOLUTE PERMEABILITY OF FREE SPACE and has a symbol μ_0 .

If a magnetic material such as iron is placed inside the coil, the constant increases. The ratio by which the constant increases is called the RELATIVE PERMEABILITY AND has a symbol μ_r . It follows that:

$B/H = \mu_0 \mu_r$

It is difficult to apply this to a simple coil as the length of the magnetic circuit is not obvious unless the coil is wound on a magnetic material to produce a circuit.

Suppose our circuit is the simple toroid again. For the electric analogy we have Ohm's Law V/I = R By analogy, in the magnetic circuit m.m.f/ ϕ = reluctance

Substitute B = ϕ/A and H = m.m.f./1 into the equation above and $\phi 1/(A \text{ m.m.f.}) = \mu_0 \mu_r$ Rearrange and m.m.f/ $\phi = 1/(A\mu_0\mu_r)$ = Reluctance

Reluctance = $1/A\mu_0\mu_r$ The units are A T/Wb

WORKED EXAMPLE No. 3

In example No.2 the magnetic core has a relative permeability of 300. Calculate the reluctance, the flux and the flux density. The cross sectional area of the core is 50 mm^2 .

SOLUTION

Reluctance = $1/A\mu_0\mu_{\Gamma} = 0.157 / (50 \times 10^{-6} \times 12.566 \times 10^{-7} \times 300) = 8.33 \times 10^{6} \text{ AT/Wb}$ m.m.f/ ϕ = reluctance ϕ = m.m.f. / reluctance = 1000/8.33 x 10⁶ = 120 x 10⁻⁶ Wb B = ϕ/A = 120 x 10⁻⁶/50 x 10⁻⁶) = 2.4 T


CHECK WITH B = $\mu_0 \mu_r H$ = 12.566 x 10⁻⁷ x 300 x 6366.2 = 2.4 T

SELF ASSESSMENT EXERCISE No. 1


1. The diagram shows a coil wound on a toroid. Determine the following.

- (i) The m.m.f. (320 Ampere Turns)
- (ii) The flux. $(1.675 \times 10^{-4} \text{ Wb})$
- (iii) The flux density. (3.35 T)
- (iv) The magnetising force. (5333 Ampere Turns/metre)

 $A = 50 \text{ mm}^2$ I = 60 mm T = 80 Turns $\mu_r = 500$ I = 4 Amps

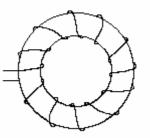


- The diagram shows a coil wound on a ring core.
 Determine the current which produces a flux of 800 μWb. (8.5Amps)
 - $\mu_r = 300$ A = 500 mm² l = 0.4 m T = 200 Turns

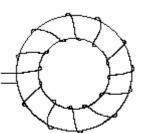

3. FORCE ON A CONDUCTOR - MOTOR PRINCIPLE

3.1 <u>FORCE</u>

A major discovery leading to the invention of the electric motor was that a conductor placed in a magnetic field experiences a force when current flows in it. Consider a conductor placed in a gap between the poles of a magnet. When current passes through the conductor, we have two magnetic fields, the circular lines around the conductor and the parallel lines between the poles. The lines of magnetism between the north and south poles would rather pass over the top of the conductor because both lines are in the same direction on top. The lines behave like elastic bands and force the conductor down. If the direction of either the current or the magnetic field is reversed, the force will act up.

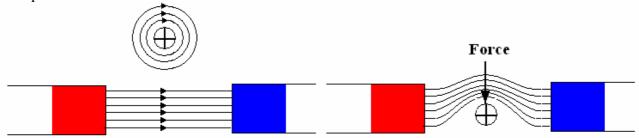

The force on the conductor is directly proportional to the current 'I', the magnetic flux density 'B' and the length 'l' of the conductor within the flux. This is the important equation for the force on a conductor.

$\mathbf{F} = \mathbf{B} \mathbf{I} \mathbf{I}$


3.2 TORQUE ON A LOOP

This principle may be used to produce a simple electric motor. Consider a single loop coil placed in the magnetic field as shown. The current flows into one side and out of the other. This produces a downwards force on one side and an upwards force on the other at a radius R. This produces a torque on the coil of T = F R. This will make the loop rotate and but when it turns 90° the radius is

zero and the torque is zero so it will stop.


If we reverse the current as it passes the 90° position the torque will continue to make it rotate. Switching the direction of the current every half rotation will produce continuous rotation. This can be done with a split ring as shown.

The design is further improved by using several loops and switching the current to the one in the horizontal position all the

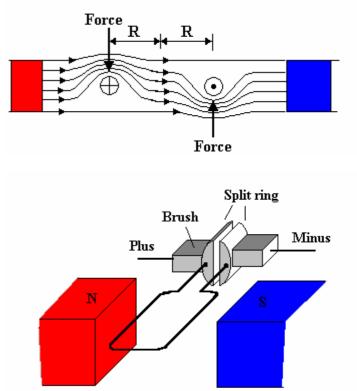


time. The split ring becomes a commutator with many segments. Each pair of segments is connected to a loop and each pair in turn becomes connected to the brushes as it rotates.

3.3 MOVING COIL METER

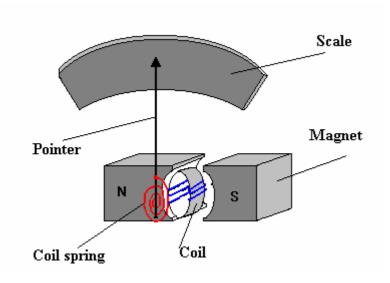

Modern instruments for measuring electric current are electronic with digital indication. The moving coil instrument uses the motor principle to indicate current and although not now used, the same principle is used in many other forms of electromechanical equipment.

The loop or coil rotates only 90^o and rotation is governed by a spring. The loop is connected to a pointer which moves on a scale. The movement is directly proportional to current in the coil.

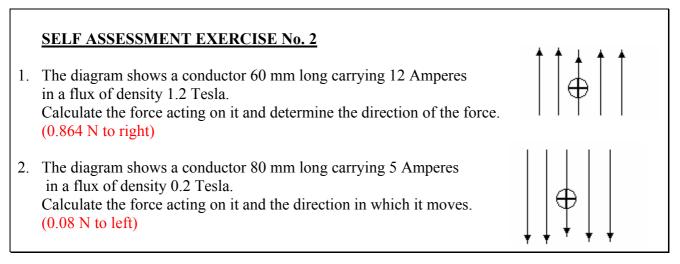


4 <u>THE GENERATOR PRINCIPLE</u>

4.1 COIL AND MAGNET


Discoveries by people like Oersted and Faraday established that an electric current can be generated by moving a conductor relative to a magnetic field so that it cuts the lines of flux.

This is best demonstrated by inserting a magnet into a coil as shown. The magnet is inserted in the coil and all the flux cuts across the turns of the conductor at 90^o and induces an e.m.f. An e.m.f. is generated only when the magnet is moved. Changing the direction of movement changes the polarity of the e.m.f.

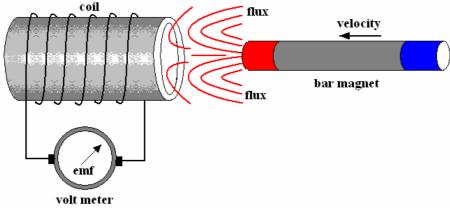

4.2 CONDUCTOR CROSSING A UNIFORM FLUX

We will come back to the coil later. Now consider a conductor crossing a flux as shown. As it moves a voltage is generated in it. If current is produced then the voltage will be reduced slightly by the resistance of the conductor. The ELECTRO MOTIVE FORCE or E.M.F. is the theoretical voltage as though the conductor had no resistance and this is denoted with the symbol e. Note that e is used for e.m.f. when the values are instantaneous and changing. E is used for a constant value.

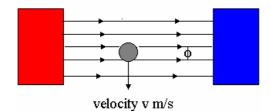


The E.M.F. is directly proportional to the flux density B, the velocity v and the length of the conductor within the flux l. It follows that the e.m.f. is given by:

e = B l v

This is the generator equation. Because electrical energy is generated it follows that mechanical energy must have been used up and this explains why a force is required to move the conductor. **LENZ'S LAW** states that the direction of the induced current is always such that, by its electromagnetic reaction, it tends to prevent the motion responsible for inducing the current.

4.3 FLEMING'S RIGHT HAND RULE

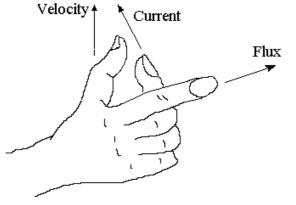


The direction of the current generated is found from Fleming's Right Hand Rule. Point the index finger of your right hand in the direction of the flux (North to South). Point your thumb in the direction of the velocity. Bend over the second finger and it points the direction of the current.

© D.J.Dunn freestudy.co.uk

4.4 **CONSTRUCTION OF GENERATOR**

A simple generator may be constructed exactly the same as the simple motor. Instead of passing current into the loop, the loop is made to rotate and a voltage is generated across the end of the loop. The current flowing from the terminals is governed by the resistance connected between them (e.g. the resistance of a light bulb).

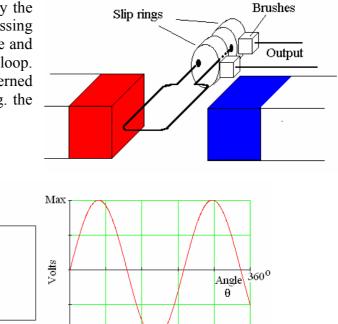


The voltage generated is directly proportional to the angle of the loop to the flux ' θ '. The output voltage is given by

$V = V_{max} \sin \theta$


V max is the maximum voltage and θ is the angle of rotation. The simple generator shown produces alternating current which is sinusoidal in form.

If the coil is connected to a split ring, the polarity is reversed every half revolution and the output is a direct current consisting of half sinusoidal waves.

The e.m.f. is generated in the armature and the current is tapped off through brushes. If many coils are used with a commutator, the output can be made into a constant DC form.

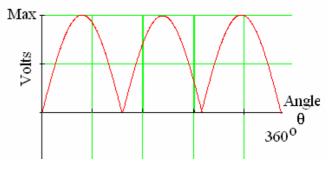

The diagram below shows a schematic of the generator with a load across the terminals. The armature resistance represents the resistance of the coil. The ideal voltage generated is E but when a current I flows, the terminal voltage is given by $V = E - I R_a$

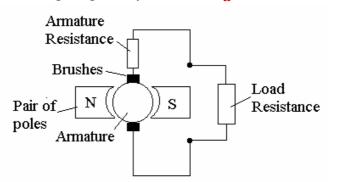


Note that since electrical energy is generated, mechanical energy must be used to turn the coil (Lenz's Law).

SELF ASSESSMENT EXERCISE No. 3


1. The diagram shows a conductor moving through a flux. The length is 80 mm and the flux density is 2 Tesla. The velocity is 12 m/s. Calculate the emf produced and the direction of the current.

(1.92 V into the page)

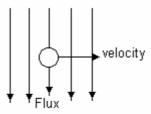

2. The diagram shows a conductor moving through a flux. The length is 100 mm and the flux density is 1.8 Tesla. The velocity is 2 m/s. Calculate the emf produced and the direction of the current.

(0.36 V out of page)

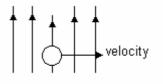

5. <u>ELECTRO-MAGNETIC INDUCTION</u>

5.1 <u>E.M.F. GENERATED IN A COIL</u>

Consider the case of a magnet being moved into a coil as discussed earlier. An alternative formula for calculating the e.m.f. is:-

e = rate of change of flux x n

n is the number of turns on the coil.

The rate of change of flux may be expressed in calculus form as the instantaneous value $d\phi/dt$

$e = n d\phi/dt$


volt meter

coil

This is known as Faraday's Law. We know that when a current flows in a coil, a magnetic flux is generated. If we generate a current we also generate a magnetic field in the coil and this will produce a force of repulsion between the magnet and the coil so that mechanical work has to be done to move the magnet. This is the source of the energy produced in the current.

5.2 INDUCTORS

Any coil of wire is an inductor. A coil made specifically for an electric circuit is called an inductor. The diagram shows the symbols for one with an air core and one with a magnetic core.

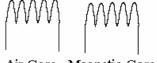

Air Core Magnetic Core


An ideal Inductor has no affect on direct current. In reality they have a

small resistance in the copper wire. When alternating current is applied, electro-magnetic induction produces a reaction. Inductors and capacitors are examples of REACTIVE components because their properties are affected by the frequency of the current flowing through it. Resistors are not affected and are called PASSIVE.

Consider a coil in which alternating current is flowing. The current produces an alternating magnetic flux.

The alternating flux cuts across the coil and generates an e.m.f. that is opposite in sense to the applied voltage. This is called the back e.m.f. This opposes the flow of the applied current (Lenz's Law) and a minus sign is used in Faraday's law.

$e = -n d\phi/dt$

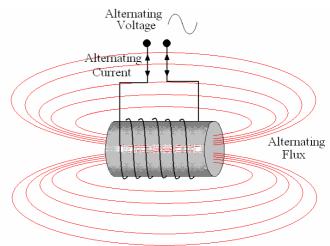

flux

velocity

bar magnet

The applied voltage must be equal and opposite. This means that even though there is no resistance in the coil, a voltage is required to make alternating current flow. This voltage depends on the rate of change and hence the frequency. This is not resistance it is called REACTANCE.

6. **TRANSFORMERS**

6.1 **DESCRIPTION**

Transformers are devices for changing alternating voltages and currents. The types of transformers vary from very large to very small. Very large ones are used for transforming the a.c. power generated at a power station to and from a high voltage grid. Smaller ones are used to transform the mains voltage down to a useable level such as 12 V for use in electronic equipment. These have largely been replaced by modern electronic devices that are much smaller, lighter and cheaper. In other areas of electronics such as radio receivers, small transformers working at high frequencies are common.




SUB STATION TRANSFORMER



Small transformers for electronic equipment

6.2 <u>PERFECT TRANSFORMER</u>

A perfect transformer has two coils placed in close proximity to each other. An alternating voltage is applied to one coil called the primary winding and this produces an alternating magnetic flux ϕ . The flux cuts the turns of the second coil called the secondary winding and generates an e.m.f. at the same frequency. If the secondary voltage is smaller than the primary we have a 'step down' transformer. If the voltage is larger we have a 'step up' transformer.

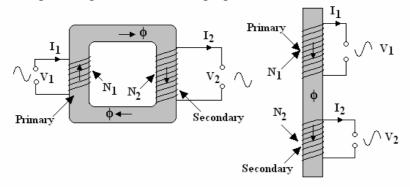

In order to make all the flux ϕ cut both windings, they are either wound on a core that forms a closed loop or wound very close to each other. In this event, the ratio of the voltages is in direct proportion to the number of turns on each winding such that:

$V_1/V_2 = N_1/N_2$

In the ideal transformer, the electric power going in at the primary would be the same as the power coming out of the secondary. In this case:

 $P_1 = V_1 I_1 = P_2 = V_2 I_2$ Hence $V_1 / V_2 = I_2 / I_1 = N_1 / N_2$

Note that if the voltage is stepped up, the current is stepped down and vice versa.

6.3 <u>REAL TRANSFORMERS</u>

Real transformers are affected by energy losses. These fall into two main groups -CORE LOSS and COIL LOSS


6.3.1 CORE LOSS

Large power transformers have iron cores and these become hot and lose energy because of HYSTERESIS and EDDY CURRENTS. The core losses are near constant and are not affected by

the current flowing in the coils. Hysteresis was explained earlier and heats up the iron core of a transformer and this is an energy lost.

EDDY CURRENTS

The alternating flux generates electricity in the magnetic core material. As this is a short circuit, random currents flow in the material and dissipate energy as heat due to the electrical resistance. In order to reduce this, larger transformers have cores made from laminate iron sheets and each layer is insulated from each other.

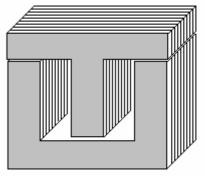

EFFICIENCY η

In simple terms the efficiency of a transformer is the ratio of the Power in top the power out but this is complicated by the power factor of the load. The primary is referred to as 1 and the secondary as 2.

 $\eta = \frac{\text{Power Out}}{\text{Power In}} = \frac{P_2}{P_1}$

WORKED EXAMPLE No. 4

A 5/1 step down transformer has a full load secondary current of 20 A 500V. The primary winding has 800 Turns.

Assuming ideal conditions determine the following.

(i) The number of turns on the secondary coil.

(ii) The voltage and current in the primary winding.

SOLUTION

 $N_2 = N_1/5 = 800/5 = 160$ turns

$$\frac{N_1}{N_2} = \frac{I_2}{I_1} = 5 \quad I_1 = \frac{20}{5} = 4 \text{ A}$$

 $V_1 = 5V_2 = 5 \ge 500 = 2500 V$

If the transformer has losses due to a secondary resistance of 0.3 Ω and no other losses, determine the efficiency of the transformer.

SOLUTION

Power loss in the secondary = $I^2 R = 20^2 x 0.3 = 120 W$

Ideal Power input = $V_2 I_2 = 20 \times 500 = 10 \text{ kW}$ Actual Power out = 10 000 - 120 = 9880 W Ideal Power Input = 10 kW $\eta = \frac{\text{Power Out}}{\text{Power In}} = \frac{9880}{10000} = 0.988 \text{ or } 98.8\%$

SELF ASSESSMENT EXERCISE No. 4

- 1. A simple high frequency transformer with negligible losses is required to transform 0.05 V rms to 1 V rms. The primary has 10 turns. How many turns should the secondary have? (200)
- 2. An ideal step down transformer must change 240 V rms into 12 V rms. The secondary winding has 20 turns and produces 5 A.

Assuming ideal conditions determine the following.

(i) The number of turns on the primary coil. (400)

(ii) The current in the primary winding. (0.25 A)

(iii)The efficiency if the 15 W are lost in the secondary winding. (75 %)